



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	349	Date:	10/26/2004	MeterBasin:	01_WR18
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	3	Priority CCTV:	

House Number	5819	Street Prefix:		Street Name:	Stuart	Street Type:	AVE
Source Type:	18= Other	Location:	2=Paved Asphalt	Severity:	4=Major		
Sector:	1=Public	Drainage Area:	4000				
Comments:	storm cover on 0692147 san sewer on Cross Country Blvd						

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 906

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0906.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 3
349

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 1320
Crew: T2	Street Location: Cross Country Rd		
US MH: 0692250	DS MH: 0692376	Number of Segments: 8	Test Length: 1828'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

0692147 is below grade, has a storm m.h. cover (many vent holes), & is along the curb.
This is a major inflow source

CREW COMMENTS

The overflow has been concreted shut but heavy smoke still comes out of the overflow. The creek also has risen a couple of feet above the invert of the overflow.

Last Revised 9/16/2004
Leader Form

Sketch No:

349

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\349.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6111		Eastcliff	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses; sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004

Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6106		Eastcliff	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004 Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	1	Priority CCTV:	

House Number	6104	Street Prefix:		Street Name:	Eastcliff	Street Type:	DR
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	100				
Comments:							

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 615

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-3\PLAYER_A\A_2004_1026Image0615.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004 Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	4	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6101		Eastcliff	DR

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004

Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	5	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6107		Eastcliff	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses; sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004 Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	6	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6109		Eastcliff	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

350

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004 Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	7	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6204		Gernand	ROAD

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004

Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	350	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	8	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6202		Gernand	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 1

350

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0740
Crew: T3	Street Location: GERMAN RD & EASTCLIFF DR.		
US MH: 0691052	DS MH: 0691037	Number of Segments: 6	Test Length: 1017'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y N	Recorder: JMM	Comments: CNF 0691059, 0691042, 0691044, 0691038	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

0691038 PROBABLY DOES NOT EXIST.

Last Revised 9/16/2004 Leader Form

Sketch No: 350

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\350.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	351	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1807		Kenway	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH


Page 1 of 2
Smoke Set No. 16
Setup No. 2

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

351

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0845
Crew: T3	Street Location: KENWAY RD		
US MH: 0691039	DS MH: 0691043	Number of Segments: 4	Test Length: 756'
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

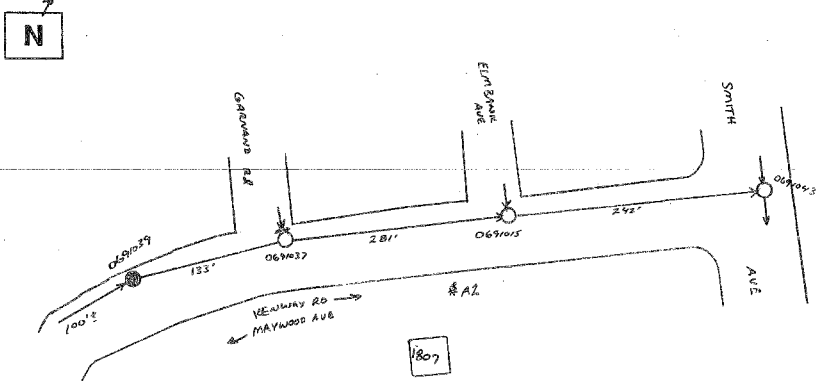

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 351

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\351.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	351	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	2	Priority CCTV:	

House Number	1807	Street Prefix:		Street Name:	Kenway	Street Type:	ROAD
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	200				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 616

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-3\PLAYER_A\A_2004_1026Image0616.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH


Page 1 of 2
Smoke Set No. 16
Setup No. 2

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

351

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 0845
Crew: T3	Street Location: KENWAY RD		
US MH: 0691039	DS MH: 0691043	Number of Segments: 4	Test Length: 756'
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

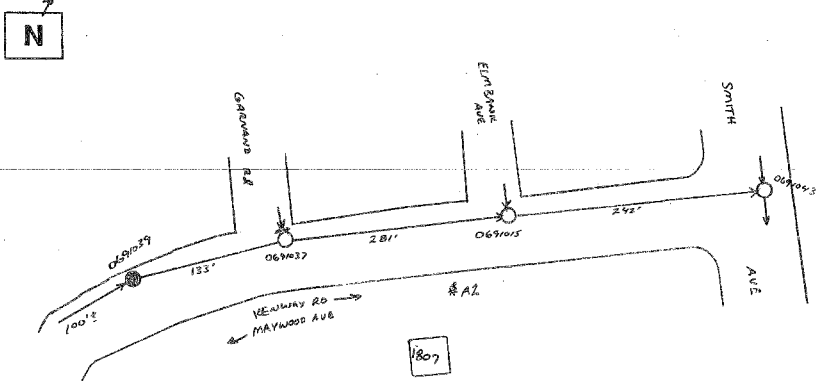

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 351

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\351.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	352	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6205		Elmbank	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 16
Setup No. 3

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-05	Start Time: 0930
Crew: T3	Street Location: ELMBANK AVE + WALNUT AVE		
US MH: 0691011	DS MH: 0691015	Number of Segments: 3	Test Length: 714'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y N	Recorder: JMM	Comments: CNF 0691012	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004 Leader Form

Sketch No: 352

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\352.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	353	Date:	10/26/2004	MeterBasin:	
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	0	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

353

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1030
Crew: T3	Street Location: SMITH AVE + EASMENT N.R. KENWAY RD.		
US MH: 0691044	DS MH:	Number of Segments: 8	Test Length: 1158'
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers 12/3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691046	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004 Leader Form

Sketch No: 353

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\353.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	354	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	5	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1809		Dixon	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 5

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1320
Crew: T3	Street Location: DIXON RD		
US MH: 0691159	DS MH: 0691048	Number of Segments: 3	Test Length: 660'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 123	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691160	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

N

CREW COMMENTS

DO NOT THINK 0691160 EXISTS

Last Revised 9/16/2004 Leader Form

Sketch No: 354

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\354.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	354	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	5	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6014		Smith	AVE

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 5

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1320
Crew: T3	Street Location: DIXON RD		
US MH: 0691159	DS MH: 0691048	Number of Segments: 3	Test Length: 660'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 123	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691160	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

N

CREW COMMENTS

DO NOT THINK 0691160 EXISTS

Last Revised 9/16/2004 Leader Form

Sketch No: 354

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\354.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	354	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	5	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1802		Dixon	ROAD

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 5

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1320
Crew: T3	Street Location: DIXON RD		
US MH: 0691159	DS MH: 0691048	Number of Segments: 3	Test Length: 660'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691160	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

N

CREW COMMENTS

DO NOT THINK 0691160 EXISTS

Last Revised 9/16/2004
Leader Form

Sketch No: 354

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\354.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	354	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	4	Setup No:	5	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1808		Dixon	ROAD

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH


Page 1 of 2
Smoke Set No. 16
Setup No. 5

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1320
Crew: T3	Street Location: DIXON RD		
US MH: 0691159	DS MH: 0691048	Number of Segments: 3	Test Length: 660'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed: Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CNF 0691160	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

N

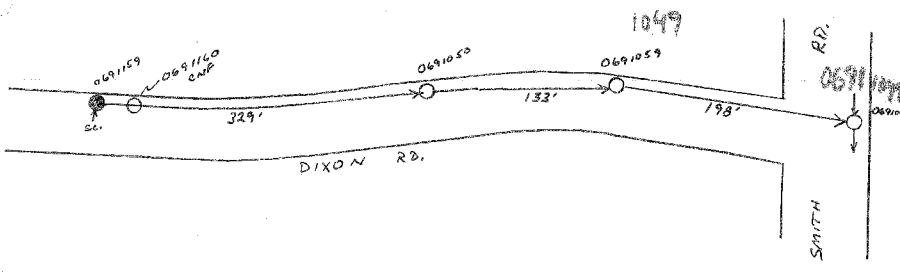

CREW COMMENTS

DO NOT THINK 0691160 EXISTS

Last Revised 9/16/2004 Leader Form

Sketch No: 354

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\354.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	355	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1700		Terrace	ROAD

Source Type:	04= Cleanout	Location:	11=Field	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:	the terraces # 17				

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 6

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

355

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1400
Crew: T3	Street Location: SMITH AV.		
US MH: 0691048	DS MH: 0691704	Number of Segments: 4	Test Length: 825'
Plugged US: Y <input checked="" type="checkbox"/> M	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

FLOW TOO FAST + TOO MUCH TO PLUG

Last Revised 9/16/2004

Leader Form

Sketch No: 355

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\355.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	356	Date:	10/26/2004	MeterBasin:	
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6505		Maywood	AVE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 7

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

356

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1440
Crew: T3	Street Location: MAYWOOD AVE + THORNBLAY RD		
US MH: 0691151	DS MH: 0691152	Number of Segments: 6	Test Length: 1055'
Plugged US: Y <input checked="" type="radio"/> N	Plugged DS: Y <input checked="" type="radio"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y <input checked="" type="radio"/> N	Recorder: JAH	Comments: CUP 0691153 OR 0691157	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 356

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\356.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	356	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1806		Thornbury	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 7

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1440
Crew: T3	Street Location: MAYWOOD AVE + THORNBLAY RD		
US MH: 0691151	DS MH: 0691152	Number of Segments: 6	Test Length: 1055'
Plugged US: Y <input checked="" type="radio"/> N	Plugged DS: Y <input checked="" type="radio"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y <input checked="" type="radio"/> N	Recorder: JAH	Comments: CUP 0691153 OR 0691157	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 356

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\356.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	356	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1809		Thornbury	ROAD

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 7

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1440
Crew: T3	Street Location: MAYWOOD AVE + THORNBLAY RD		
US MH: 0691151	DS MH: 0691152	Number of Segments: 6	Test Length: 1055'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y <input checked="" type="checkbox"/> N	Recorder: JAH	Comments: CUP 0691153 OR 0691157	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 356

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\356.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	357	Date:	10/26/2004	MeterBasin:	
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	0	Setup No:	8	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 8
(357)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1500
Crew: T3	Street Location: THORNBURY RD		
US MH: 0691158	DS MH:	Number of Segments: 2	Test Length: 405'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: JMM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

N

CREW COMMENTS

Last Revised 9/16/2004
Leader Form

Sketch No: 357

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\357.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	358	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	9	Priority CCTV:	

House Number	5912	Street Prefix:		Street Name:	Smith	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9
358

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1605
Crew: T3	Street Location: SMITH AVE		
US MH: 0691704	DS MH: 0692151	Number of Segments: 6 +	Test Length: 1026'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 3	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: JMM	Comments: CWF 0691545, 0691548, 0691695	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

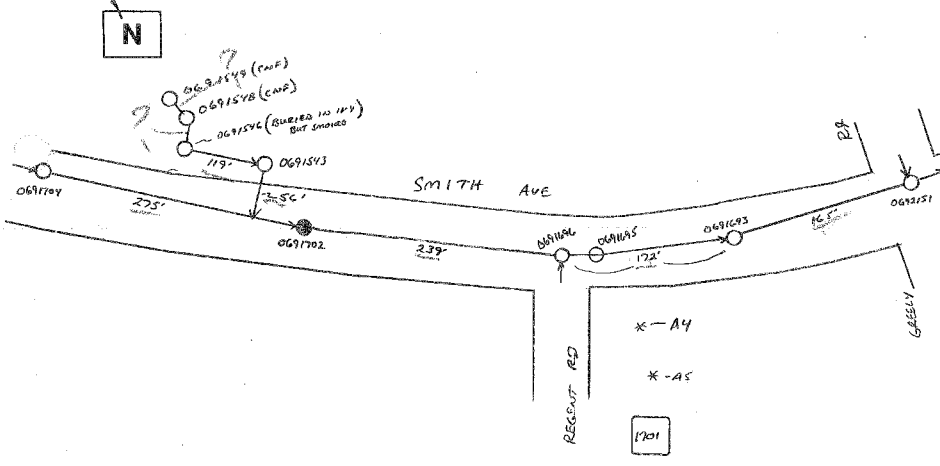

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 358

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\358.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	358	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	9	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5920		Smith	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9
358

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1605
Crew: T3	Street Location: SMITH AVE		
US MH: 0691704	DS MH: 0692151	Number of Segments: 6 +	Test Length: 1026'
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 2 3	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? Y <u>N</u>	Recorder: JMM	Comments: CWF 0691545, 0691548, 0691695	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 358

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\358.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	358	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	9	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5902		Smith	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9
358

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1605
Crew: T3	Street Location: SMITH AVE		
US MH: 0691704	DS MH: 0692151	Number of Segments: 6 +	Test Length: 1026'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y N	Recorder: JMM	Comments: CWF 0691545, 0691548, 0691695	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

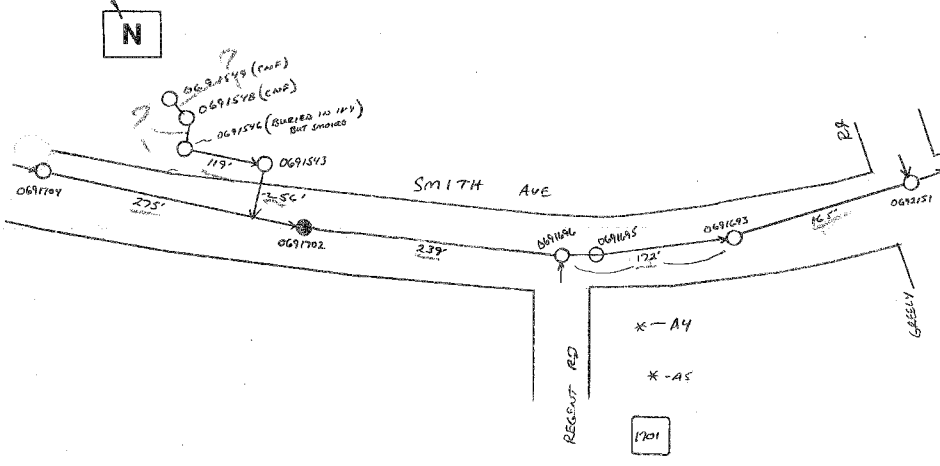

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 358

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\358.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.